



## Project-information

Project name:  
**Nexus**

Contract number:  
**1172**

Contact:

Date:  
**14/06/2007**

Client **Nexus Security Systems**  
 Contact: **Paul Stoddart**  
 Position:  
 Road **Trinity Halls**  
 Town **1 Bryan Road**  
 County **London, SE16 5HF**  
 Telephone: **0870-974-2308**  
 Fax: **0870-974-2303**  
 Mobile: **07956-559217**  
 E-Mail: **p.stoddart@nexussecuritysystems.com**

Site **Nexus Security Systems**  
 Contact: **Brenda Johnson**  
 Position: **Home-Owner**  
 Road **11 Greig Terrace**  
 Town **Brandon Estate**  
 County **London, SE17 5QS**  
 Telephone: **07941-045023**  
 Fax:  
 Mobile:  
 E-Mail:

Contractor **London Drainage Facilities**  
 Contact: **Lucie Fuller**  
 Position: **Administration**  
 Road **PO Box 2728**  
 Town **Romford, Essex**  
 County **RM4 1XF**  
 Telephone: **0870 116 2179**  
 Fax: **0870 919 2179**  
 Mobile:  
 E-Mail: **lucie@london-drainage.com**

# Inspection report

Date: <b>14/06/2007</b>	Job N°: <b>1172</b>	Weather: <b>Dry</b>	Operator: <b>Graham Dal</b>	section number: <b>1</b>	PLR: <b>MH1-Run1 X</b>
Present:	Vehicle: <b>CE56 UUJ</b>	Camera:	Preset:	Cleaned:	Grade:

Road: <b>11 Greig Terrace</b>	Division:	start MH: <b>MH1-Run1</b>
Place: <b>London, SE17 5QS</b>	District:	end MH: <b>Gully</b>
Location: <b>Front Path</b>	Tape No.: <b>DVD</b>	Total length: <b>3.5 m</b>

Purpose: <b>Find cause of bad smells</b>	Size/Shape: <b>Circular 100</b>
Use: <b>Rainwater</b>	Material: <b>Polyester Liner to Vitrified Clay</b> Pipe length:
Catchment:	Lining: <b>No</b>
	Category:

Comment: **Pipe requires cleaning and lining**

Location details:

1:50	position	code	observation	grade
<p>Depth: 680mm</p>				
	0.00	ST	Start of Survey	(Misc) 0
	0.20	DE	Debris, Start	(Serv) 1
	1.05	MC	Material changes at this point, Vitrified Clay	(Misc) 0
	2.18	CC	Circumferential Crack, from 09 to 03 o'clock	(Struct) 2
	3.06	CC	Circumferential Crack, from 12 to 12 o'clock	(Struct) 2
	3.10	JDM	Joint displaced. Medium	(Struct) 1
	3.50	FH	Finish Survey, Remark: Connection to Rainwater Gully	(Misc) 0
<p>Depth: 400mm</p>				
				0.2 m // 00:00:00
				2.18 m // 00:00:00
				3.06 m // 00:00:00
				3.1 m // 00:00:00
				3.1 m // 00:00:00

Structural Defects

Constructional Features

Service Defects

Miscellaneous Features

### Inspection photos

Place: <b>London, SE17 5QS</b>	Road: <b>11 Greig Terrace</b>	Date: <b>14/06/2007</b>	section number: <b>1</b>	PLR: <b>MH1-Run1 X</b>
-----------------------------------	----------------------------------	----------------------------	-----------------------------	---------------------------



Photo: 2a, Tape No.: DVD, 00:00:00  
 0.2m, Debris, Start



Photo: 1\_4a, Tape No.: DVD, 00:00:00  
 2.18m, Circumferential Crack, from 09 to 03 o'clock



Photo: 12a, Tape No.: DVD, 00:00:00  
 3.06m, Circumferential Crack, from 12 to 12 o'clock



Photo: 1\_6a, Tape No.: DVD, 00:00:00  
 3.1m, Joint displaced. Medium

### Inspection photos

Place: <b>London, SE17 5QS</b>	Road: <b>11 Greig Terrace</b>	Date: <b>14/06/2007</b>	section number: <b>1</b>	PLR: <b>MH1-Run1 X</b>
-----------------------------------	----------------------------------	----------------------------	-----------------------------	---------------------------



Photo: 6b, Tape No.: DVD, 00:00:00  
3.1m, Joint displaced. Medium



# Inspection report


Date: <b>14/06/2007</b>	Job N°: <b>1172</b>	Weather: <b>Dry</b>	Operator: <b>Graham Dal</b>	section number: <b>2</b>	PLR: <b>MH1-Run2 X</b>
Present:	Vehicle: <b>CE56 UJJ</b>	Camera:	Preset:	Cleaned:	Grade:

Road: <b>11 Greig Terrace</b>	Division:	start MH: <b>MH1-Run2</b>
Place: <b>London, SE17 5QS</b>	District:	end MH: <b>W/W Stack</b>
Location: <b>Front Path</b>	Tape No.: <b>DVD</b>	Total length: <b>2.07 m</b>

Purpose: <b>Find cause of bad smells</b>	Size/Shape: <b>Circular 100</b>
Use: <b>Waste Water</b>	Material: <b>Vitrified Clay</b> Pipe length:
Catchment:	Lining: <b>No</b>
	Category:


Comment: **Pipe requires cleaning/descaling**

Location details:

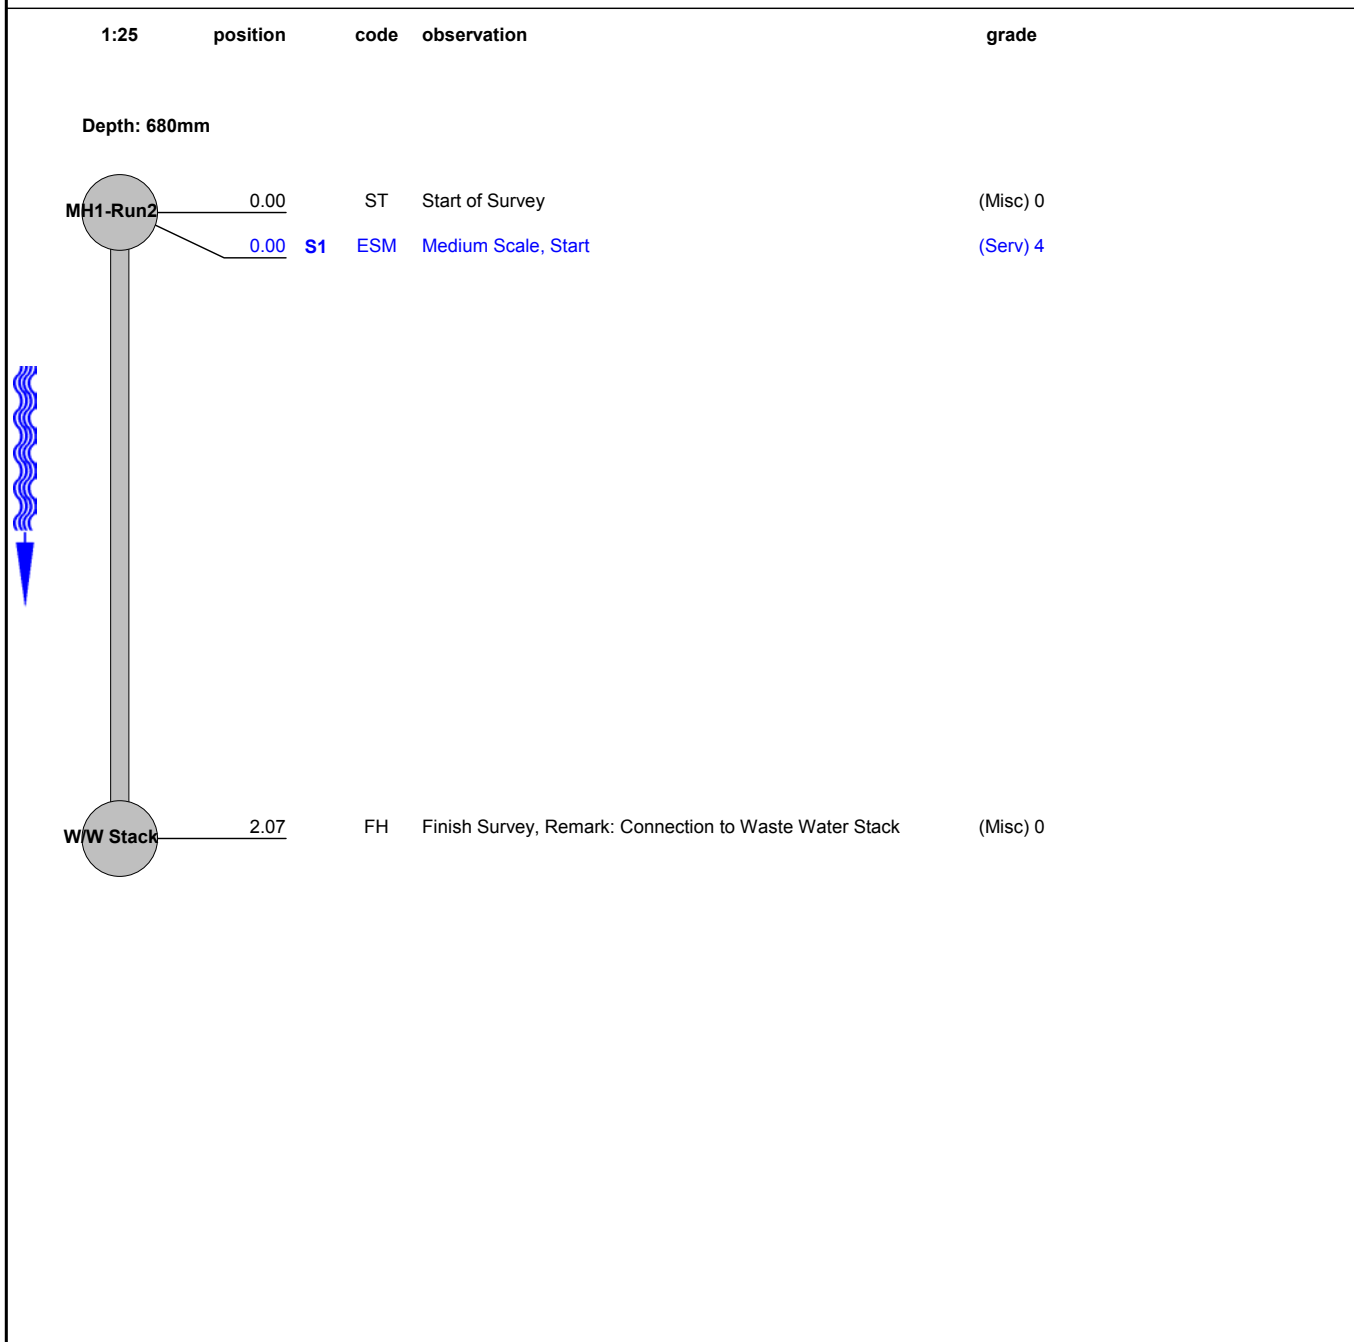

<b>Structural Defects</b>	<b>Constructional Features</b>
<b>Service Defects</b>	<b>Miscellaneous Features</b>

No.: <b>3</b>	PLR: <b>MH1-Run3 X</b>	Date: <b>14/06/2007</b>	Operator: <b>Graham Dal</b>	Job nr.: <b>1172</b>	Tape No.: <b>DVD</b>
Cleaned:	Present:	Catchment:	Vehicle: <b>CE56 UJJ</b>	Map No.1:	Map No.2:
Road: <b>11 Greig Terrace</b>	start MH: <b>MH1-Run3</b>	Material: <b>Vitrified Clay</b>			
Town: <b>London, SE17 5QS</b>	end MH: <b>WC</b>	Size/Shape: <b>Circular, 100</b>			
Location: <b>Front Path</b>	section length: <b>3 m</b>	Joint length:			
Reason for inspection: <b>Find cause of bad smells</b>	Section use: <b>Soil</b>	Year laid:			
Remark: <b>Pipe requires cleaning/descaling</b>					

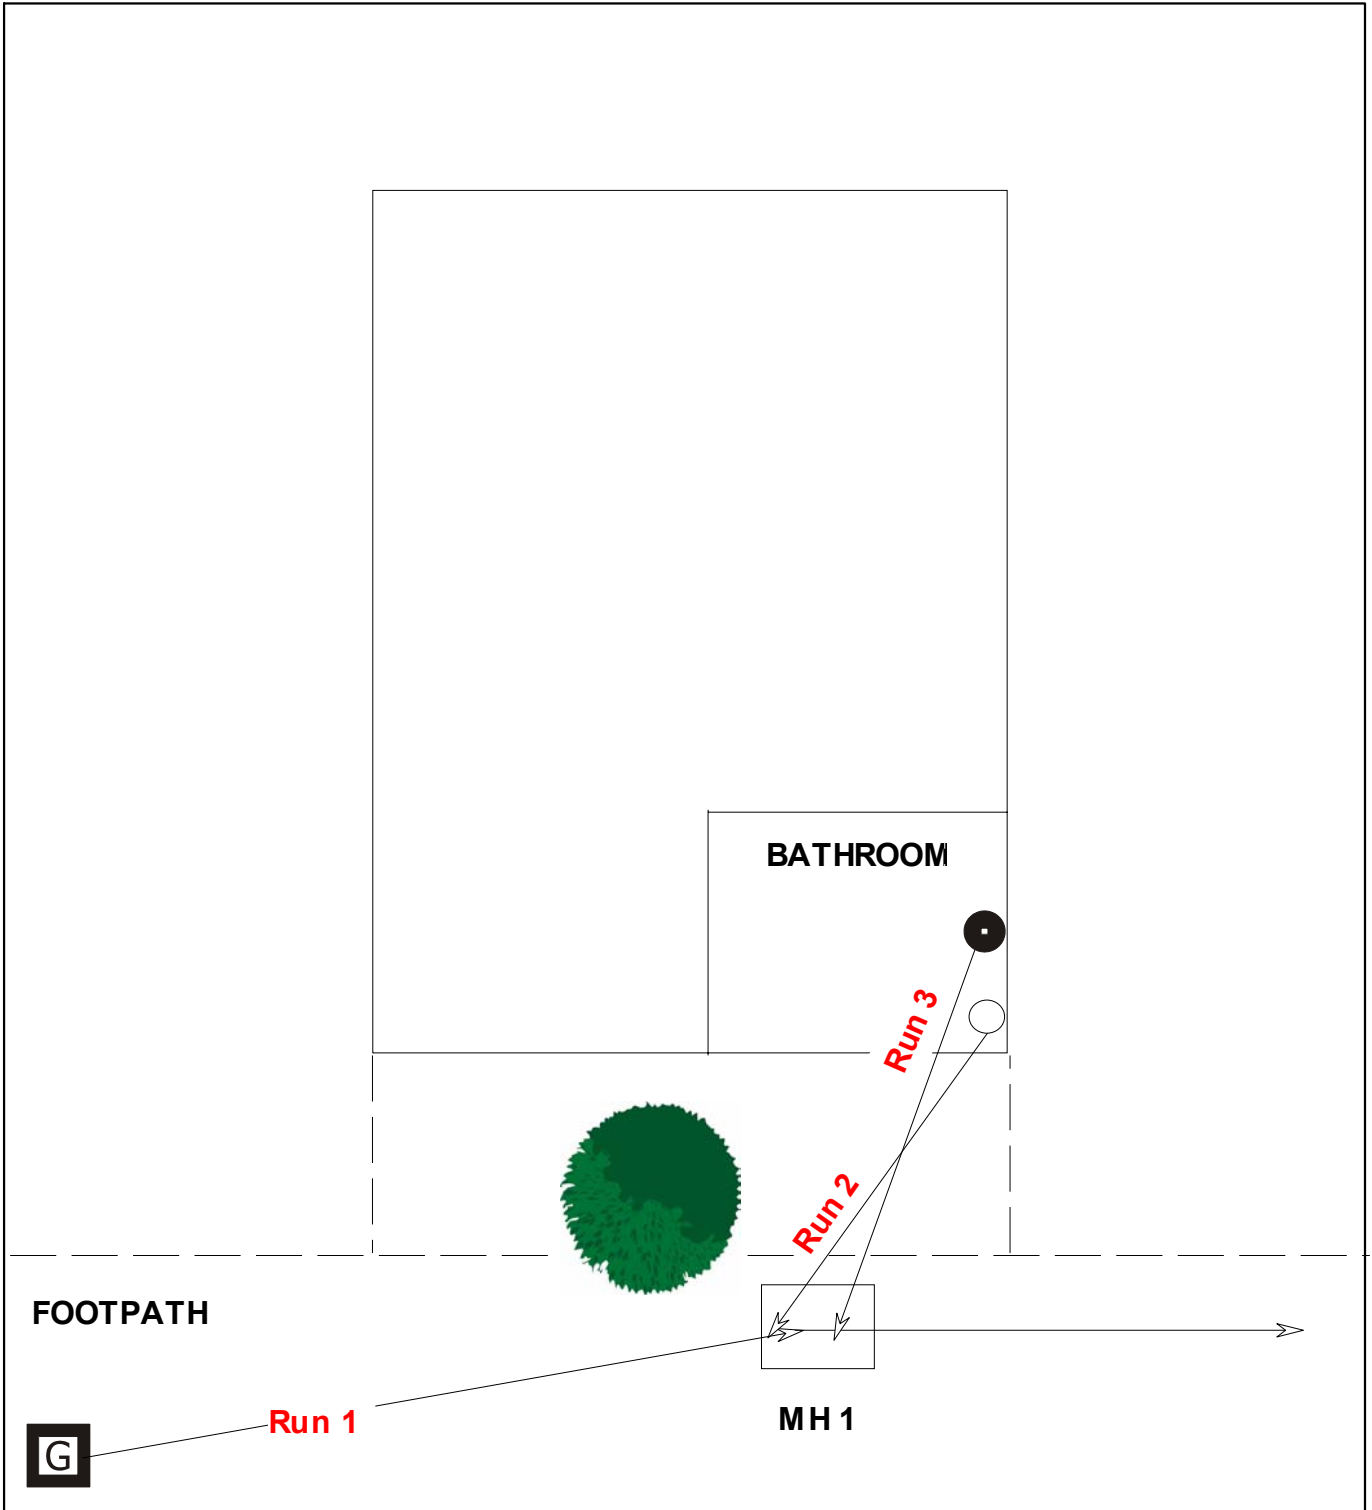



# Inspection report


Date: <b>14/06/2007</b>	Job N°: <b>1172</b>	Weather: <b>Dry</b>	Operator: <b>Graham Dal</b>	section number: <b>3</b>	PLR: <b>MH1-Run3 X</b>
Present:	Vehicle: <b>CE56 UJJ</b>	Camera:	Preset:	Cleaned:	Grade:

Road: <b>11 Greig Terrace</b>	Division:	start MH: <b>MH1-Run3</b>
Place: <b>London, SE17 5QS</b>	District:	end MH: <b>WC</b>
Location: <b>Front Path</b>	Tape No.: <b>DVD</b>	Total length: <b>3 m</b>

Purpose: <b>Find cause of bad smells</b>	Size/Shape: <b>Circular 100</b>
Use: <b>Soil</b>	Material: <b>Vitrified Clay</b> Pipe length:
Catchment:	Lining: <b>No</b>
	Category:

Comment: **Pipe requires cleaning/descaling**

Location details:

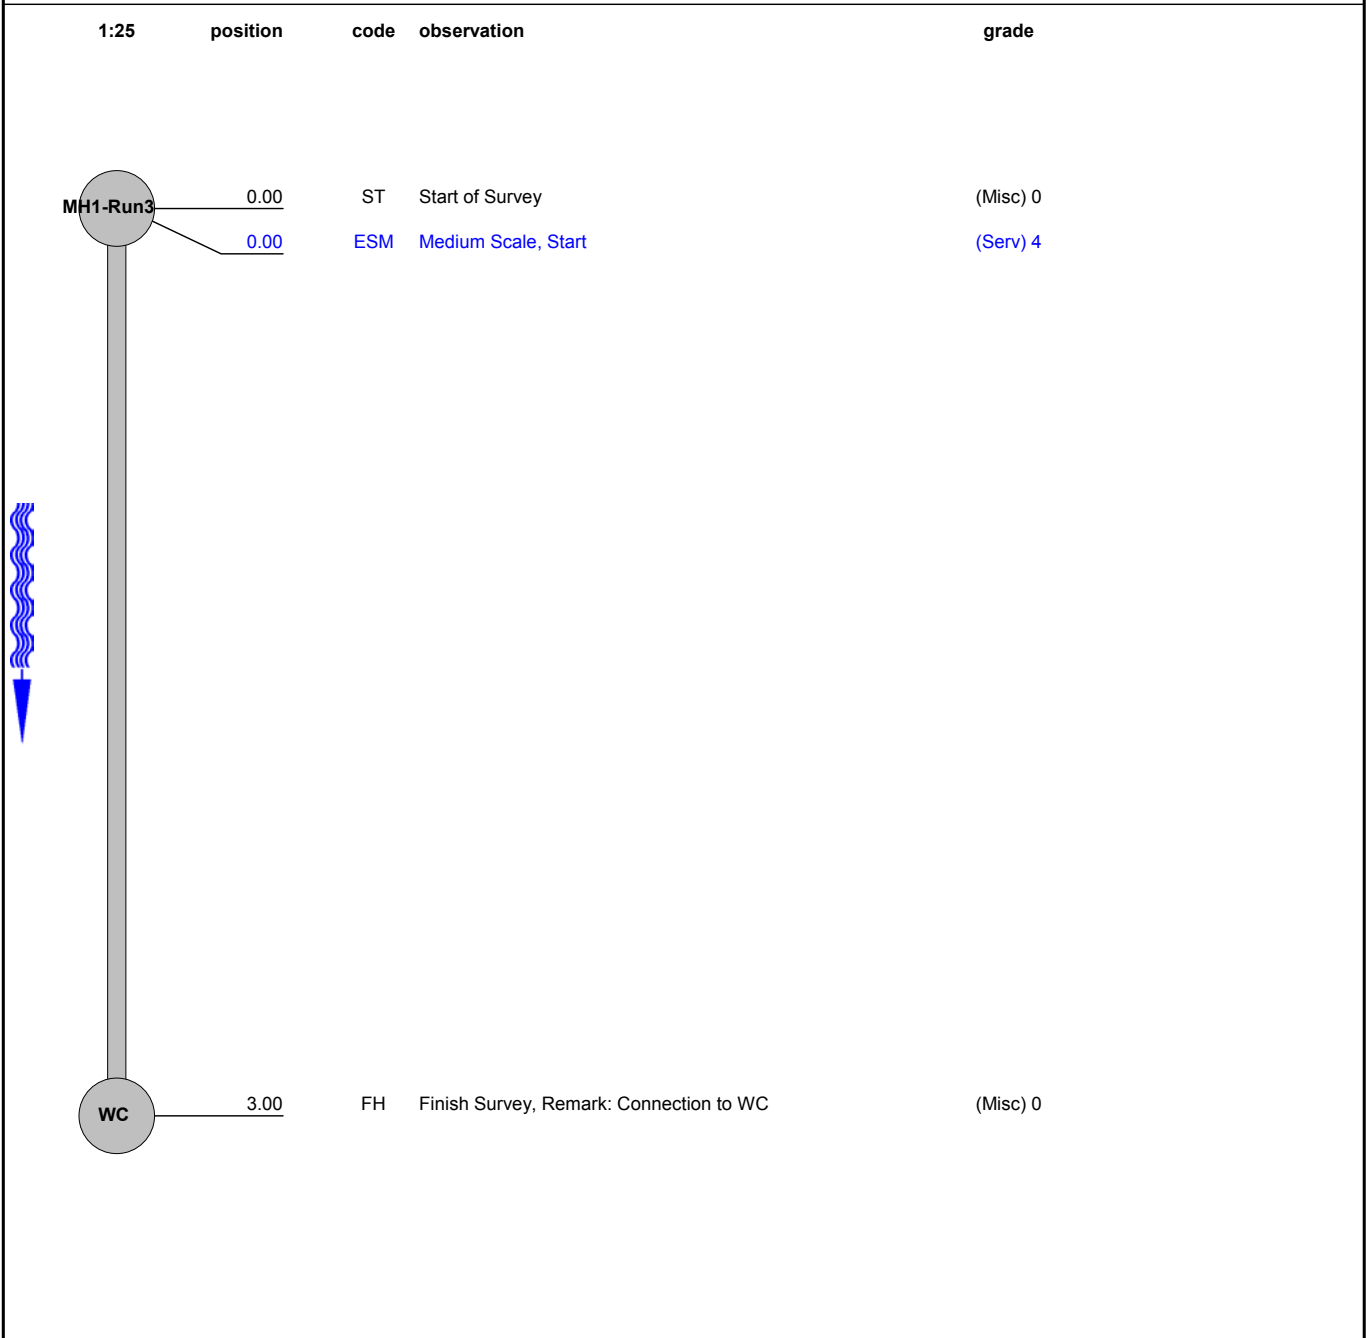

<b>Structural Defects</b>	<b>Constructional Features</b>
<b>Service Defects</b>	<b>Miscellaneous Features</b>